

Technical Information	Date: 12.03.2018 Official: Marier Department: BT-FIR/MKP3
------------------------------	---

Tech. Information No.	2158 / 2018
Subject:	FPA-5000 firmware 2.20.6: sporadic FNM-420-x fault messages displayed

Short Description:	In rare cases the combination of MPC firmware 2.20.6 and the FNM-420 series can lead to sporadic fault messages. Therefore it is required to use MPC firmware 2.20.3 which is officially released with this TI.
---------------------------	---

Hardware <input type="checkbox"/>	<input type="checkbox"/> Device	<input type="checkbox"/> Module	<input type="checkbox"/> PCBA
Software <input checked="" type="checkbox"/>	<input type="checkbox"/> Application	<input type="checkbox"/> Driver / Extension	<input checked="" type="checkbox"/> Firmware

Affected Products (details)	CTN	SAP no.	Aff. version	New version
Main Panel Controller	MPC-xxxx-C	All languages	V2.20.6	V2.20.3
Main Panel Controller	MPC-xxxx-B	All languages	V2.20.6	V2.20.3
Main Panel Controller	FPA-1200-MPC-C	All languages	V2.20.6	V2.20.3
Main Panel Controller	FPA-1200-MPC	All languages	V2.20.6	V2.20.3
Main Panel Controller	FPA-1100-DE	F.01U.316.057	V2.20.6	V2.20.3

Number of delivered devices		
Period of delivery	from:	to:
Affected serial numbers	from:	to:

Priority Level	Criterion
I	<input type="checkbox"/> The change has to be made immediately (see dates below)
II	<input type="checkbox"/> The change has to be made during the next inspection.
III	<input checked="" type="checkbox"/> Change has to be made, if the error pattern recurs and with new installations.
None	<input type="checkbox"/> General Information (like new tool, new feature, new SW release)

Action Plan	
<input checked="" type="checkbox"/>	Inform customers
<input type="checkbox"/>	Arrange re-work of stock (CSO)
<input type="checkbox"/>	Arrange re-work of stock (customer)
<input type="checkbox"/>	Arrange re-work of installed products
<input checked="" type="checkbox"/>	See detailed actions on following pages

Start Date		Completion Date	
-------------------	--	------------------------	--

New Features

MPC 2.20.3:

- Support of the new Day Mode LED
This LED is switched on if the day mode is active. This LED is visible even if the display is switched off (dark mode). This is required when alarm verification could be invoked in case of an alarm.
- The day / night mode symbol is also displayed with a sun and or moon icon. Additionally a split icon showing half a sun and half a moon was introduced. If this icon is visible, the network panel you are looking at is in night mode, but other nodes in the scope are in day mode.

Problem description

Sounders of the FNM-420 series may report a trouble when connected to a panel controller running on firmware 2.20.6. Those troubles can appear up to 2 days after restarting the panel controller. The reason is, that the monitoring for affected sounders reports a missing device even though it is fully functional. They can be reset and return to normal state afterwards. However, they may reappear again at any given time.

Note: In case of a fire alarm the configured sounders will get activated, even if they show a trouble related to this error description.

Cause**Action**

Before replacing the firmware 2.20.6 with 2.20.3, please upload the existing 2.20 configuration to your computer. The previously uploaded configuration can be downloaded directly to a panel controller running the firmware 2.20.3.

Notes

Download all technical bulletins (TIs) and released software from the '[ST-FIR Tech Support](#)' sharepoint (registered users only)

Required Components	Part no.

Attachment(s)**BU Manager**

Knauel

Clerk in Charge:

Marier

Distribution

Distribution BU FIR	<input checked="" type="checkbox"/> Julian Tersteegen (ST-FIR/QMM), Claudia Majer (ST-FIR/QMM), Knauel Thomas (ST-FIR/MKP ST-FIR/MKT), Heckl Michael (ST-FIR/MKP3) <input checked="" type="checkbox"/> Angstenberger Josef (ST-FIR/MKR-EU) <input checked="" type="checkbox"/> Ong Kah Seong (ST-FIR/MKR-AP), Leonard Hew (ST-FIR/MKR-AP) <input checked="" type="checkbox"/> Paredes Ivan (ST/MKR-LA), Miers Christopher (ST/FIR-MKT) <input checked="" type="checkbox"/> Haug Stefan (ST-FIR/MKR-EU ST-FIR/MKA-EU)
Distribution BU IN	<input type="checkbox"/> Endres Dirk (ST-IN/QMM), Kachel Roxanne (ST-IN/QMM), Gueche Sandra (ST-IN/MKP-EU), Hupka Peter (ST-IN/MKP-EU), Weissert Thorsten (ST-IN/MKP-EU), Clemens Jasper (ST-IN/CLP-EU MKP-EU), Poessnecker Peter (ST-IN/CLP-EU) <input type="checkbox"/> Gudduschat Cordula (ST-IN/MKT MKR-EU), Kugler Gerhard (ST-IN/MKR2-EU), Berberian Alexandra (ST-IN/MKR-SEF), Tantry Ananth (ST-IN/MKR-SEM), Karlsson Mathias (ST-IN/MKR-SEN), Gomez Arevalo Olga (ST-IN/MKR-SEI), Malek Michal (ST-IN/MKR-SEP), Oppab Maria (ST-IN/MKR-SAN) <input type="checkbox"/> Squarize Alex (ST/SRM-LA ST-FIR/MKR-LA), Garms Paul (ST-IN/MKR-NA) <input type="checkbox"/> Borden Scott (ST-IN/ENG-EU), Meichelbeck Markus (ST-IN/ENG-EU) <input type="checkbox"/> Schmidt Michaela (ST-IN/MKW) <input type="checkbox"/>
Distribution BU ESS	<input type="checkbox"/> Tan Boon Chuan (ST-ESS/MKP1.4), Maier Holger (ST-ESS/MKP1.2), Wings Maarten (ST-ESS/MKP1.3), Redeker Bernd (ST-ESS/QMM), Jan von Rosenstiel (ST-ESS/MKP1.1), Jekelius Friederike (ST-ESS/MKP1) <input type="checkbox"/> Funke Thomas (ST-ESS/ENG) <input type="checkbox"/> Nikolas Mangold-Takao (ST-ESS/MKP1), Jaco Liebetrau (ST-ESS/MKT) <input checked="" type="checkbox"/> Markus Brack (ST-ESS/MKP2.3), Huse Istvan (ST/PRM2-EU) <input type="checkbox"/> Gary Deng (ST-PRM-CN), Roth Christy (ST-IN/MKR-NA), Claude Hochreutiner (ST-ESS/MKR-AP), Mauricio Santos (ST/SPS-LA), Mikhail Zyrianov (ST-ESS/MKR-EU ST-ESS/MKR-SEP) <input type="checkbox"/> Bies Geert (ST-ASA/MKP1)
Other parties affected	<input checked="" type="checkbox"/> Schrimpff Felix (ST-ASA/PRM) <input checked="" type="checkbox"/> Proyer Konrad (ST-ASA/SRA-EU), Wilson Jim (ST-ASA/SRA-NA), Tan Woo Khiang (ST-ASA/SRA-AP) <input checked="" type="checkbox"/> Grunewald Theresa (ST-ASA/STS3-EU); Gill Manjit (ST-ASA/STS-UK) <input checked="" type="checkbox"/> Teleservice Support (SO/OMM7.3-Mb) <input type="checkbox"/> Becker Oliver (ST-IE/PRM1) <input checked="" type="checkbox"/> Schwichtenberg Heiko (ST-IE/PRM2) <input type="checkbox"/>