

<b>Technical Information</b>	Date: 05.09.2016 Official: Erhard Department: ST-IN/MKA-EU
------------------------------	--

<b>Tech. Information No.</b>	2042 / 2016
<b>Subject:</b>	Modular Alarm Platform 5000

<b>Short Description:</b>	[EN] Software-Update MAP 5000 Bundle V1.43.1 - Improvements in reporting with SIA-DC09 protocol [DE] Software-Update MAP 5000 Bundle V1.43.1 - Verbesserungen bei Übertragung mit SIA-DC09 Protokoll
---------------------------	---

<b>Hardware</b> <input type="checkbox"/>	<input type="checkbox"/> Device	<input type="checkbox"/> Module	<input type="checkbox"/> PCBA
<b>Software</b> <input checked="" type="checkbox"/>	<input checked="" type="checkbox"/> Application	<input type="checkbox"/> Driver / Extension	<input checked="" type="checkbox"/> Firmware

Affected Products (details)	CTN	SAP no.	Aff. version	New version
Main Panel/Zentralenmodul	ICP-MAP5000-2	F.01U.245.556	1.4.0020	1.4.0023
Main Panel/Zentralenmodul	ICP-MAP5000-COM	F.01U.289.149	1.4.0020	1.4.0023
Main Panel/Zentralenmodul	ICP-MAP5000-S	F.01U.296.016	1.4.0020	1.4.0023
Main Panel/Zentralenmodul	ICP-MAP5000-SC	F.01U.299.120	1.4.0020	1.4.0023
Control Center/Bedienteil	IUI-MAP0001-2	F.01U.245.557	1.3.9050	1.3.9060
RPS for MAP	RPS for MAP		1.20.0.71	1.20.0.78

<b>Number of delivered devices</b>		
<b>Period of delivery</b>	from:	to:
<b>Affected serial numbers</b>	from:	to:

Priority Level	Criterion
I <input type="checkbox"/>	The change has to be made <b>immediately</b> (see dates below)
II <input type="checkbox"/>	The change has to be made during the next inspection.
III <input checked="" type="checkbox"/>	Change has to be made, if the error pattern recurs and with new installations.
None <input type="checkbox"/>	General Information (like new tool, new feature, new SW release)

Action Plan	
<input type="checkbox"/>	Inform customers
<input type="checkbox"/>	Arrange re-work of stock (CSO)
<input type="checkbox"/>	Arrange re-work of stock (customer)
<input type="checkbox"/>	Arrange re-work of installed products
<input checked="" type="checkbox"/>	See detailed actions on following pages

<b>Start Date</b>	09.09.2016	<b>Completion Date</b>	Additional
-------------------	------------	------------------------	------------

Print out of this template is not subject of the updating service. Only the version in the Intranet is always up to date.

Error(s) and Effect(s)
<p>[EN] New/changed features:</p> <p>Reporting via SIA-DC09 protocol:</p> <ul style="list-style-type: none"> <li>- Adding event information on detector and area level</li> <li>- Adding names for points, areas and users in plain text as configured</li> </ul> <p>Control Center:</p> <p>Improvement of the responsiveness of the touch screen surface.</p> <p>Modification of the order of options in the "Arm" and "Disarm" menu. Options will be displayed in the following order:</p> <ul style="list-style-type: none"> <li>&gt; (Dis)Arm local Area</li> <li>&gt; (Dis)Arm selected Areas</li> <li>&gt; [Dis]Arm all Areas</li> </ul> <p>An accordingly modified user manual will be available by end of September.</p> <p>[EN] Fixed Defects:</p> <p>In rare cases a time model for Smartkey devices may not work as configured, e.g.</p> <ul style="list-style-type: none"> <li>- an action may not be executed on a configured day.</li> <li>- an action may be executed with a delay of one hour</li> </ul> <p>[DE] Neue/geänderte Leistungsmerkmale:</p> <p>Ereignisübertragung via SIA-DC09 Protokoll:</p> <ul style="list-style-type: none"> <li>- Hinzufügen von Ereignisinformationen auf Melder- und Bereichsebene</li> <li>- Hinzufügen von Melder-/Bereichs- und Benutzernamen im Klartext wie parametrier</li> </ul> <p>Bedienteil:</p> <p>Verbesserung der Empfindlichkeit der Touchscreen Oberfläche.</p> <p>Änderung der Reihenfolge der Optionen in den Menüs "Scharfschalten" und "Unscharfschalten". Optionen werden nun in folgender Reihenfolge angezeigt:</p> <ul style="list-style-type: none"> <li>&gt; Lokalen Bereich (un)scharf schalten</li> <li>&gt; Ausgewählte Bereiche (un)scharf schalten</li> <li>&gt; Alle Bereiche (un)scharf schalten</li> </ul> <p>Eine entsprechend geänderte Bedienungsanleitung steht bis Ende September zur Verfügung.</p> <p>[DE] Behobene Fehler:</p> <p>In seltenen Fällen kann ein Zeitmodell für Smartkey nicht wie parametrier schalten, z.B.</p> <ul style="list-style-type: none"> <li>- eine Aktion kann an einem bestimmten Tag nicht ausgeführt werden</li> <li>- eine Aktion kann mit Verzögerung von 1 Std. ausgeführt werden</li> </ul>
Cause
<p>[EN] New features and Bug Fix</p> <p>[DE] Neue Leistungsmerkmale und Fehlerbehebung</p>
Action(s)
<p>[EN] Install the firmware in new installations or in existing installations if one of the described error pattern occur.</p> <p>The new release "RPS for MAP" is downwards compatible, means older installations can be configured, existing configurations can still be used.</p> <p>[DE] Setzen Sie die neue Firmware bei Neuinstallationen und im Fehlerfall ein.</p> <p>Die neue Version des Parametrierprogramms „RPS for MAP“ ist abwärts kompatibel, d.h. ältere Installationen können damit parametrier werden, bestehende Parametrierungen können weiter verwendet werden.</p>

Print out of this template is not subject of the updating service. Only the version in the Intranet is always up to date.

**Attachment(s)**

[EN] For more details of the new feature and for bug fixes please see the file 'Readme.txt' attached to the download.

[DE] Für mehr Details zu den neuen Leistungsmerkmalen und zu Fehlerbehebungen lesen Sie bitte die Datei 'Liesmich.txt', die beim Herunterladen beigefügt ist.

<b>BU Manager</b>	Hossmann ST-IN/RBU-EU	<b>Clerk in Charge:</b>	Erhard ST-IN/MKA-EU
-------------------	-----------------------	-------------------------	---------------------

**Distribution**

Distribution BU FIR	<input type="checkbox"/> Celebi Guenay (ST-FIR/QMM), Knauel Thomas (ST-FIR/MKP ST-FIR/MKT), Heckl Michael (ST-FIR/MKP3) <input type="checkbox"/> Angstenberger Josef (ST-FIR/MKR-EU) <input type="checkbox"/> Lim Yong Gang (ST/SRM-AP), Leonard Hew (ST-FIR/MKR-AP), Quek Daniel (ST-CO/MKR2-AP) <input type="checkbox"/> Squarize Alex (ST/SRM-LA), Pinto Erik (ST/STS-LA ST-ASA/SRA-LA), Render Chelsea (ST/SRM-NA) <input type="checkbox"/>
Distribution BU IN	<input checked="" type="checkbox"/> Hossmann Daniela (ST-IN/RBU-EU MKP-EU MKA-EU), Endres Dirk (ST-IN/QMM), Kachel Roxanne (ST-IN/QMM), Klein Alexander (ST-IN/MKP-EU), Hupka Peter (ST-IN/MKP-EU), Weissert Thorsten (ST-IN/MKP-EU), Clemens Jasper (ST-IN/CLP-EU MKP-EU), Poessnecker Peter (ST-IN/CLP-EU) <input checked="" type="checkbox"/> Gudduschat Cordula (ST-IN/MKT MKR-EU), Kugler Gerhard (ST-IN/MKR2-EU), Berberian Alexandra (ST-IN/MKR-SEF), Tantry Ananth (ST-IN/MKR-SEM), Karlsson Mathias (ST-IN/MKR-SEN), Gomez Arevalo Olga (ST-IN/MKR-SEI), Malek Michal (ST-IN/MKR-SEP), Oppab Maria (ST-IN/MKR-SAN) <input type="checkbox"/> Squarize Alex (ST/SRM-LA ST-FIR/MKR-LA), Garms Paul (ST-IN/MKR-NA) <input checked="" type="checkbox"/> Borden Scott (ST-IN/ENG-EU), Meichelbeck Markus (ST-IN/ENG-EU) <input checked="" type="checkbox"/> Schmidt Michaela (ST-IN/MKW) <input type="checkbox"/> Adelman Petra (ST-ESS/ENG1)
Distribution BU ESS	<input type="checkbox"/> Tan Boon Chuan (ST-ESS/MKP1.4), Maier Holger (ST-ESS/MKP1.2), Wings Maarten (ST-ESS/MKP1.3), Redeker Bernd (ST-ESS/QMM), Jan von Rosenstiel (ST-ESS/MKP1.1), Jekelius Friederike (ST-ESS/MKP1) <input type="checkbox"/> Funke Thomas (ST-ESS/ENG) <input type="checkbox"/> Nikolas Mangold-Takao (ST-ESS/MKP1), Jaco Liebetau (ST-ESS/MKT) <input type="checkbox"/> Markus Brack (ST-ESS/MKP2.3), Huse Istvan (ST/PRM2-EU) <input type="checkbox"/> Gary Deng (ST-PRM-CN), Roth Christy (ST-IN/MKR-NA), Claude Hochreutiner (ST-ESS/MKR-AP), Mauricio Santos (ST/SPS-LA), Mikhail Zyrianov (ST-ESS/MKR-EU ST-ESS/MKR-SEP) <input type="checkbox"/> Bies Geert (ST-ASA/MKP1)
Other parties affected	<input type="checkbox"/> Schrimpf Felix (ST-ASA/PRM) <input type="checkbox"/> Proyer Konrad (ST-ASA/SRA-EU), Pinto Erik (ST-ASA/SRA-LA) Wilson Jim (ST-ASA/SRA-NA), Tan Woo Khiang (ST-ASA/SRA-AP) <input checked="" type="checkbox"/> Hemke Tobias (ST-ASA/STS3-EU); Gill Manjit (ST-ASA/STS-UK) <input checked="" type="checkbox"/> Teleservice Support (SO/OMM7.3-Mb) <input checked="" type="checkbox"/> Pedolzky Georg (ST-IE/PRM1) <input type="checkbox"/> <input type="checkbox"/>

Print out of this template is not subject of the updating service. Only the version in the Intranet is always up to date.